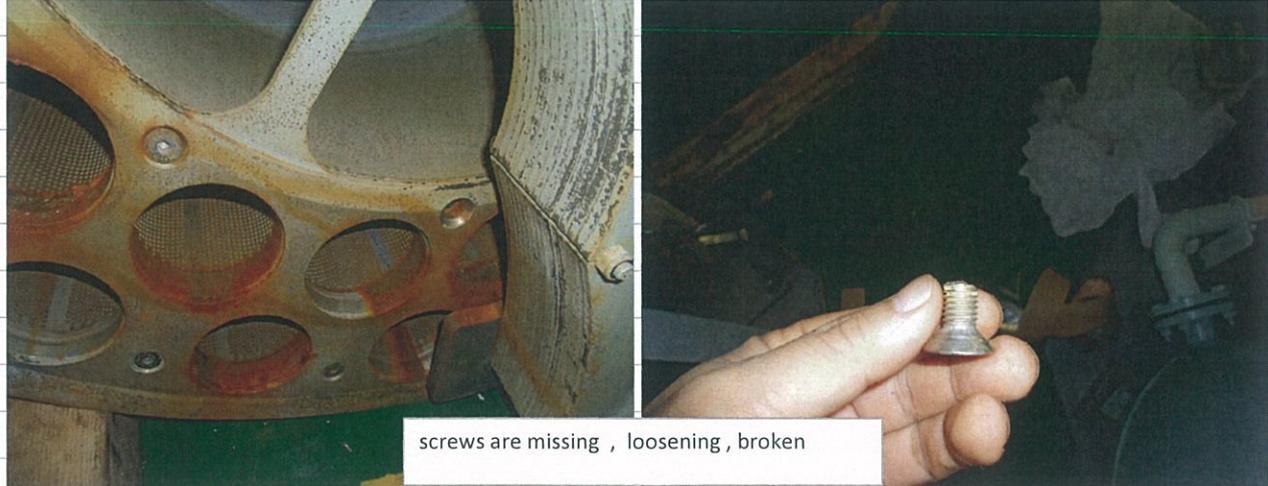




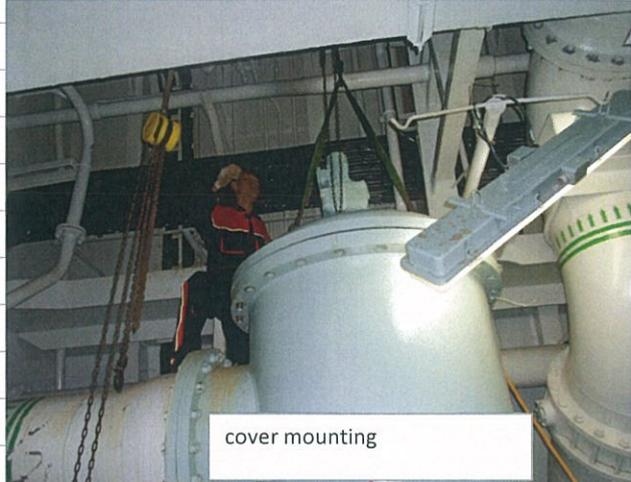
# Service Report

TIME SCHEDULE	WORK REPORT
	<p>1) No. 1 filter</p>  <p>The image shows a close-up of a rectangular metal label mounted on a light green surface. The label contains the following text: 'BOLLFILTER' logo, 'Automatic 6.18.3', 'Baugröße 700', '4019090/1', '2014', '50', and 'Volume'. There are also some smaller, less legible markings.</p>
	 <p>The left photograph shows two workers in dark clothing and safety gear standing on a platform, pulling a large, vertical, cylindrical metal filter insert. The right photograph shows a similar scene from a different angle, with the filter insert being hoisted by a chain and pulley system.</p> <p>filter insert pulling out</p>
	 <p>The left photograph is a close-up of the filter insert's internal structure, showing several circular mesh screens and a metal frame. The right photograph shows a hand holding a small, cylindrical metal screw or bolt.</p> <p>screws are missing , loosening , broken</p>

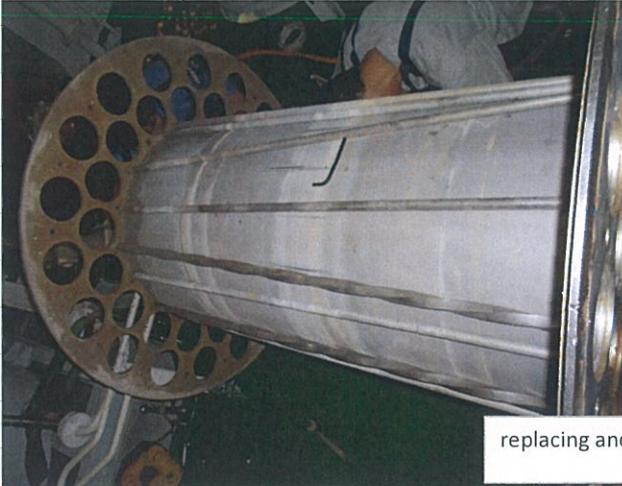
# Service Report

TIME SCHEDULE	WORK REPORT
	 <p data-bbox="598 786 1061 846">replacing anchor bar , new screws tightening</p>
	 <p data-bbox="703 1294 979 1355">missing lower gasket</p>
	 <p data-bbox="539 1803 1225 1863">re-assembling filter insert with twisted anchor bar and new screws</p>

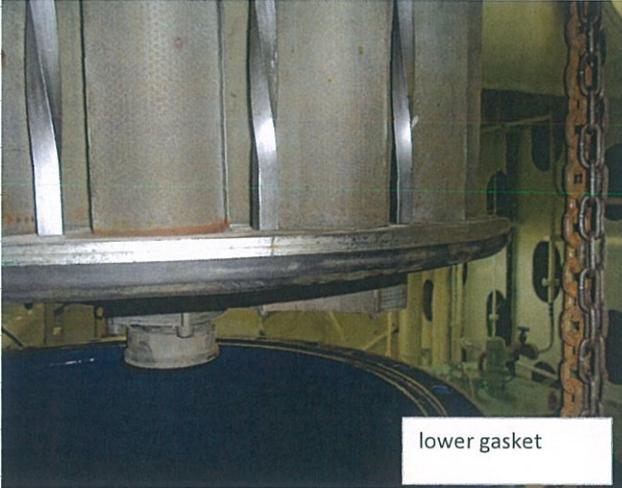
# Service Report

TIME SCHEDULE	WORK REPORT
 <p data-bbox="215 795 766 828">filter inserting in position. good hand turning of flushing</p>	 <p data-bbox="1061 795 1220 817">cover mounting</p>

# Service Report

TIME SCHEDULE	WORK REPORT
	<p>2 ) No. 2 filter</p> 
	  <p>filter insert pulling out</p>
	  <p>replacing anchor bar</p>

# Service Report

TIME SCHEDULE	WORK REPORT
	 <p data-bbox="204 770 735 824">one element without mesh. due to heavy damage of mesh, crew took off the mesh</p> <p data-bbox="855 779 995 801">broken screws</p>
	 <p data-bbox="512 1294 1155 1323">re-assembling filter insert with twisted anchor bar and new screws</p>
	 <p data-bbox="603 1800 730 1823">lower gasket</p> <p data-bbox="871 1809 1422 1832">filter inserting in position. good hand turning of flushing</p>

